

GX-30ARC – Current Firmware Update Notes

Update History

Current Version 1.10

1. Adjusted sound quality for improved performance.
2. Added Auto Standby setting (default: On).
This can be changed by holding down the Enter button on the remote control.
 - **On:** After the LED Source Indicator blinks, both the LED Source Indicator and the LED Flat Sound Mode Indicator briefly light up in green.
 - **Off:** After blinking, both the LED Source Indicator and the LED Flat Sound Mode Indicator briefly light up in red.
3. Added Auto Dimmer feature.
LEDs automatically dim slightly after 15 seconds of no operation.
4. Minor bug fixes and stability improvements.

Update instructions

Preparation:

1. Format a USB flash drive in FAT32.
Note: The update will not work with any other file system.
2. Extract the zip file and copy the resulting “ISPBOOOT.BIN” file to the root folder of the USB flash drive.
Note: Make sure there is only one BIN file on the drive. If there are multiple BIN files, the update will not work.
Note: The BIN files for both GX-10DB and GX-30ARC have the same file name, so please be careful.

Procedure:

1. Start with the AC adapter unplugged.
2. Insert the USB flash drive with the BIN file into the USB-C port on the back of the GX-30ARC.
3. When the AC adapter is connected to the GX-30ARC, the LED on the back will start blinking white, indicating that the update has started.
4. When the LED on the back turns off, the update is complete. After disconnecting the AC adapter, remove the USB flash drive.
5. Reconnect the AC adapter and power on the device. Please confirm that the firmware version has been updated correctly.

How to check Firmware Version

The number at the end of the Bluetooth device name displayed on your Bluetooth-enabled device (such as a smartphone) indicates the firmware version. **Note: After the update, re-pairing will be required.**

